DE-ICERMAN

Splice Connection Kit

DSK

User Manual

The DSK Connection Kit is for use with all versions of DSR-PFP & DSR-RGS heating cables together in a splice configuration.



TOOLS REQUIRED



KIT CONTENT



Heat shrink tubes
Ø6(3.2inch/80mm)
Qty 2



Heat shrink tubes
Ø12(1.2inch/30mm)
Qty 4



Heat shrink tubes
Ø12(4inch/100mm)
Qty 2



Heat shrink tubes
Ø16(5.5inch/140mm)
Qty 2



Insulated bus wire crimp
Qty 4



Uninsulated ground braid crimp
Qty 2

Component approvals and performance are specifically tied to the use of De-Icerman specified parts. Do not substitute any parts.

ATTENTION:

- **The maximum permissible steady state Current is 30A.**
- **The rated voltage is 240V.**
- **The maximum continuous exposure temperature is 85°C.**
- **Temperature at the point of connection to branch circuit conductors may exceed 60 °C.**

Warning: All heating cables shall have metal screen for working with branch circuit ground-fault protection to minimize the danger of fire if the heating cable is damaged or improperly installed.

STEP 1

For heating cable without outer jacket, skip Step 1, and proceed to step 2.

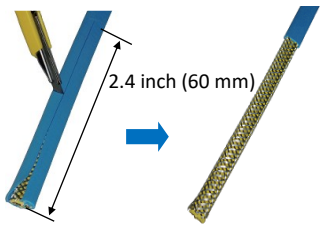

- Slightly cut the outer jacket of the cable 2.4 inch (60mm) from the top of cable.
- Remove the outer jacket from heating cable.

STEP 2

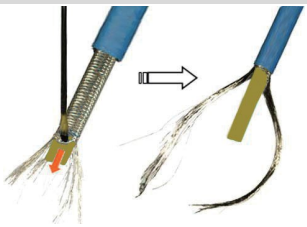

- Unbraid the braid with a screw driver or any tapered tool from the top of cable. Do not break the braiding wires.
- Disperse the braiding wires to two strands. Align and twist the two strands of braiding wires.

STEP 3

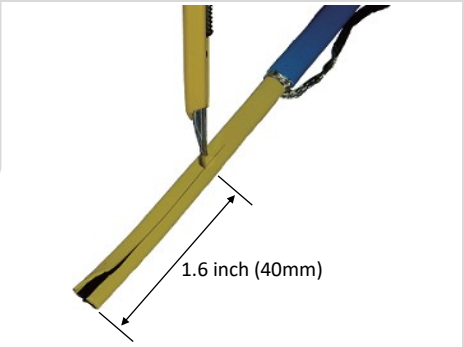

- Straighten and twist the two strands into one.
- Slightly cut the inner insulation of the cable 1.6 inch(40mm) from the top of cable.
- Remove inner insulation from heating cable.

STEP 4



- Shave the core material (Black) from the outside of each bus wire.

Warning: Do not damage the bus wires.

STEP 5

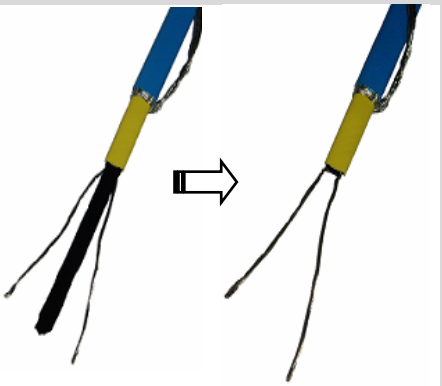

- Peel back bus wires from the core material, and remove the remaining core material.

STEP 6

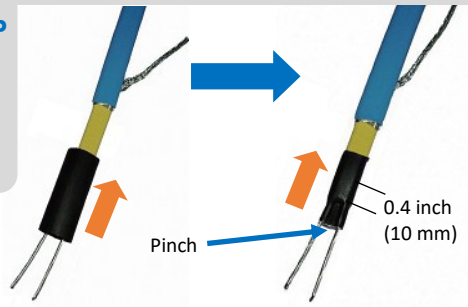

- Slide Ø12(1.2inch/30mm) shrinkable tube into place as shown.
- Heat the shrinkable tube with heat source until the glue comes out from both ends.
- Pinch the tube between two wires and hold for at least 10 seconds with pliers.
- Repeat step1 through step 6 for other heating cables.

STEP 7

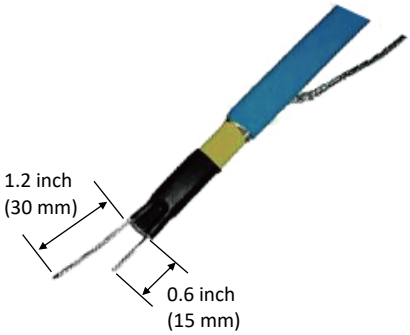

- Before splice (or tee) connecting, cut off 0.6 in(15 mm) from one of the bus wires of all cables

Warning: Bus wires will be shorted if they contact each other. Keep bus wires separated.

STEP 8

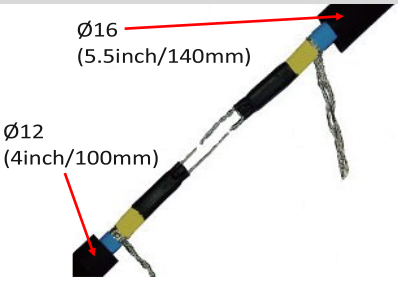

- Slide a Ø12 (5.5inch/100mm) heat shrink tube onto one of heating cables.
- Slide Ø16(4inch/140mm) heat shrink tube over another heating cable
- Place grounding braids of all heating cables on the same side.

STEP 9



- Insert both conductors into an insulated crimp terminal and clamp each set of bus wires as shown.

Crimp Tools Recommended:
Model:KST2000G
(Crimper size use : 2mm²)(K.S.T Terminals Inc.)



STEP 10



- Slide the Ø12 (4inch/100mm) heat shrink tube over the bus wire connection area.
- Heat the shrinkable tubes with heat source by moving continuously from side to side until the glue comes out from both ends.

Warning: Bus wires will be shorted if they contact each other. Keep bus wires separated.

STEP 11



- Insert all grounding braids into the Ø6 (3.2inch/80mm) heat shrink tube
- Connect the braids from both sides with an uninsulated ground braid crimp.

Crimp Tools Recommend:
Model: IZUMI 5N18
(Crimper size use : 3.5mm²)(IZUMI Products Company)



STEP 12



- Move Ø6 (3.2inch/80mm) heat shrink tube until it covers the uninsulated crimp.
- Heat the shrinkable tubes with heat source by moving continuously from side to side until the glue comes out from both ends.

STEP 13



- Slide the Ø16 (5.5inch/140mm) heat shrink tube over the bus wire connect section.
- Heat the shrinkable tube with heat source until the glue comes out from both ends.

STEP 14



DE-ICERMAN

info@deicerman.com
www.deicerman.com
1-647-894-1347